

Gas Quality Control Report

May 2018




Sample HOUSING ASSOCIATION LTD

Please Note:


With the March 2016 revision to Landlords Responsibilities under Regulation 36 of the Gas Safety (Installation & Use) Regulations, and with many traditional service procedures altered with the introduction of flue gas analysers, some inherent installation defects or quality issues of initial installation may not be recorded if they do not affect the safety or efficiency of the appliance.






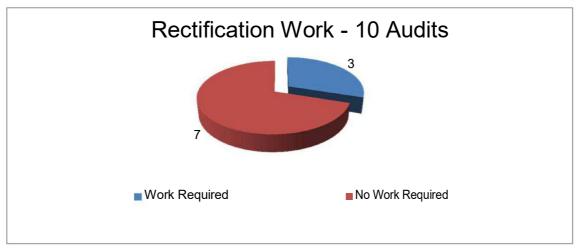


Sample HOUSING ASSOCIATION LTD

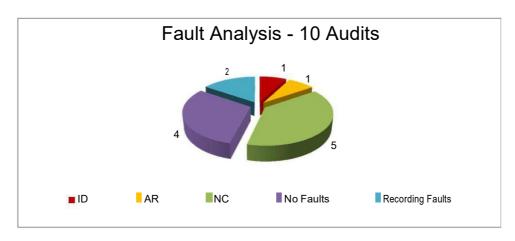

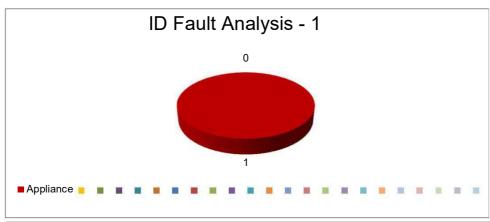


The cooker safety shut off device should have been tested and the defect actioned during the service.

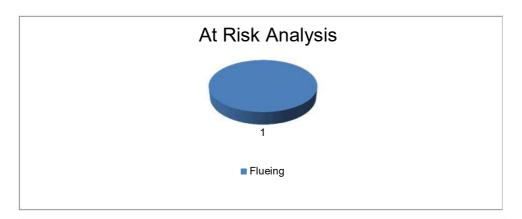

The flue needs to be inspected throughout it length as part of the service procedure. The engineer should have identified and actioned the fault.

Sample HOUSING ASSOCIATION LTD

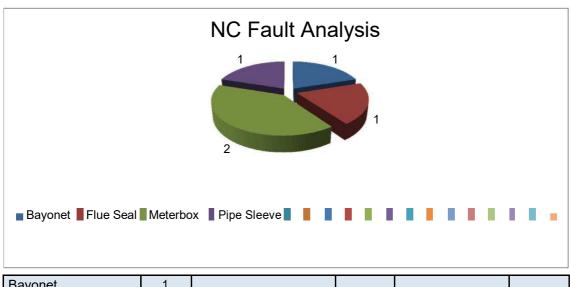

Bayonet	1		
Flue Seal	1		
Meterbox	2		
Pipe Sleeve	1		

The work on the appliance in generally satisfactory although there are a number of defects missed during the audit that the engineers need to be advised on.

Quality Control Summary Site Audits

	Cor	ntractor: Sar	ctor: Sample Gas Engineers					May 2018
	·		Sample	Gas Engineers	1 Abbey P	lace Paisley	'	
	-	This	s is a customis	ed report. Addre	ess errors a	are not recorde	ed on this sun	nmary.
Customer Name & Address	Operative	QC Inspector	completion of	Satisfactory Existing Rectification Completion of defects work Date documentation Identified required				Inspectors comments
Tenant 3 First Ave Glasgow	Eng 1	Stuart Anderson	Yes	Yes	No	Yes	13/10/2017	Meter box door missing
Tenant								Flue not adequately supported
2 Second Ave Glasgow	Eng 2	Stuart Anderson	Yes	Yes	Yes	Yes	13/10/2017	Cooker safety cut off device not operating
Cavins 4 Fifth Ave Glasgow	Eng 3	Stuart Anderson	Yes	Yes	No	No	13/10/2017	Incoming gas pipe work not sleeved/sealed
Pile		-			<u> </u>			Cooker bayonet connection fitted to close to floor level
5 Sixth Ave Glasgow	Eng 3	Stuart Anderson	Yes	Yes	No	Yes	13/10/2017	Flue not sealed Meter box door missing



Quality Control Summary Desk Top Audits

	Con	tractor: Sar	mple Gas I	Engineers				May 2018			
					1 Abbey Place Paisley						
This is a customised report. Address errors are not recorded on this summary.											
Customer Name & Address	Operative		technical		defects	Rectification work required	Completion Date	Inspectors comments			
Cavins 1 First Ave Glasgow	Eng 1	D Stormonth	Yes	Yes	Yes	No	09/10/2017	Recorded AR fault, but no paperwork been completed			
Swan 2 Second Ave Glasgow	Eng 2	D Stormonth	Yes	Yes	Yes	No	09/10/2017				
Prouse 3 Third Ave Glasgow	Eng 1	D Stormonth	Yes	Yes	Yes	No	09/10/2017				
Pike 4 Fourth Ave Glasgow	Eng 1	D Stormonth	Yes	Yes	Yes	No	09/10/2017				
Thomas 5 Fourth Ave Glasgow	Eng 3	D Stormonth	Yes	Yes	Yes	No	09/10/2017				
McMinn 6 Fourth Ave Glasgow	Eng 3	D Stormonth	Yes	Yes	Yes	No	09/10/2017	Incomplete tenant and landlord details			



SAMPLE HOUSING ASSOCIATION LTD


QUALITY CONTROL CORRECTIVE ACTION May 2018

Sample Gas Engineers

Corrective Action (1)	Date	Target Date	Implemented						
Refresh operatives on pipe work installation standards	31/05/18	30/06/18							
*need to sleeve/seal with approved materials									
	Managers signature:								
Corrective Action (2)	Date	Target Date	Implemented						
Refresh operatives on central heating installation standards	31/05/18	3 0/106/51 8 8	30/06/18						
*correct method of securing flue & extension									
	Managers sign	ature:							
Corrective Action (3)	Date	Target Date	Implemented						
Refresh operatives on cooker installation standards	31/05/18	3 0/106/51 8 8	30/06/18						
*correct/approved bayonet installation									
	Managers signature:								
Corrective Action (4)	Date	Target Date	Implemented						
Refresh operatives on meter installation standards	31/05/18	3 0/106518 8	30/06/18						
*check integrity of meter box									
	Managers signature:								
Corrective Action (5)	Date	Target Date	Implemented						
Refresh operatives on flue installation standards	31/05/18	3 0/106518 8	30/06/18						
*need to seal with approved material									
	Managers signature:								

Managers Signature:	
Date:	© Argon Technical Ltd, 2018

Sample HOUSING ASSOCIATION LTD

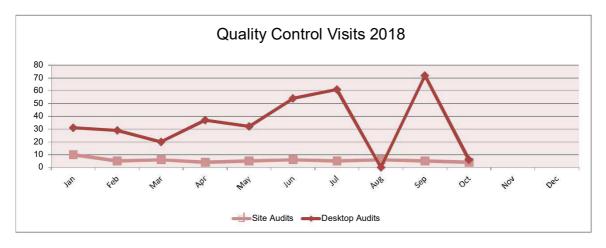

	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Total
Site Audits	10	5	6	4	5	6	5	6	5	4			56
Desktop Audits	31	29	20	37	32	54	61	0	72	6			342